

4/26/2018

[Dart Hawkesbury] Job Sheet - Gagnon-Donovan, Michelle



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D212-664-101
Job Sheet 176653



Part No: D212-664-101

Job Qty: 1 ea

Part Name: Fwd Crosstube - High



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 4/26/18

Job Tracking No:

Due Date: 5/18/18

Created By: Michelle Gagnon-Donovan

Type: Stock

Description:

Note: DWG REV E IPP Rev:E 04.02.16 Reformat KJ/DS IPP Rev:F 06-03-29 Remove Comments on Pick List JLM IPP
Rev:G 07-04-30 As per Rev C JLM IPP Rev:H 11.04.26 inspection strip ecn 11-549 EC verf by:DD IPP REV:I
14.05.27 AS PER ECN 14-570 DD VERF:JLM

Ship Via:

Bill of Materials

TRN S065238



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Container No: S066097



Part: D212-664-101

Job No: 176653

Serial No/Batch: S066097

Revision:

Inspector:

Date: 04/27/18

D212-664-101/176653/S066097

Plex 4/26/18 3:37 PM Dart.Gagnon.Michelle

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		5/18/18	0.00	0.00	Start Up Stores/Pkg-1		GP
110	Packaging	1 pcs		5/18/18	0.00	0.00	Packaging1-3		GP
120	CNC Bend Crosstubes	1 pcs		5/18/18	3.11	2.22	CNC Bend Crosstube		GP
130	QC	1 pcs		5/18/18	0.00	0.00	QC15		GP
140	Crosstubes	1 pcs		5/18/18	0.00	0.67	Crosstubes-1		GP
150	HandFXtube	1 pcs		5/18/18	0.00	0.98	HandFinish5		GP DAS
160	QC	1 pcs		5/18/18	0.00	0.00	QC7-1		38 DAS
165	QC	1 pcs		5/18/18	0.00	0.00	QC5		9-88 38
170	Outsource	1 pcs		5/18/18			SKY002-VC		AT 11/05/10
180	Packaging	1 pcs		5/18/18	0.00	0.00	Packaging2		AT 11/05/10
190	QC	1 pcs		5/18/18	0.00	0.00	QC5		38
200	SprayPaint	1 pcs		5/18/18	0.00	0.25	Spray Paint		JMD 09/05/2018
210	QC	1 pcs		5/18/18	0.00	0.00	QC14		AB MAY 11 2018
220	Crosstubes	1 pcs		5/18/18	0.00	1.69	Crosstubes-1		JMD DAS 09/05/2018
230	QC	1 pcs		5/18/18	0.00	0.00	QC5		38
240	Packaging	1 pcs		5/18/18	0.00	0.00	Packaging1-3		38 MAY 16 2018
250	QC	1 pcs		5/18/18	0.00	0.00	QC4		J.A.B. Smb
255	DC	1 pcs		5/18/18	0.00	0.00	DC		J.A.B. Smb
260	Packaging	1 pcs		5/18/18	0.00	0.00	Packaging3-1		J.A.B. Smb
270	QC21-FG	1 Ea		5/18/18	0.00	0.00	QC21		21

Part Op 120 - Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101 9-88 MAY 17 2018

Descriptions: 140 - "1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10 2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes. 3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141 4-*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141"

150 - ***IMMEDIATELY AFTER GRINDING***

170 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order 39812 MAY 09 2018

180 - Ensure copy of NDT results attached to work order.

190 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Inspect for damage & ensure results are as per Dwg D212-664-141

200 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** 1-Prime inside & outside crosstube as per QSI 005 4.2 BATCH: 138819 2- After painting remove masking and apply matte clear coat per QSI005 4.2 3- MASK UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG BEFORE PAINTING 4 -Paint Outside of Tube as per Dart QSI 005 4.2

210 - Then, Wrap in plastic bag to protect from scratches

220 - *****LAY DOWN CROSSTUBE ON TABLE AND PUT DT10302 PINS IN SADDLE HOLE FACING UP, USE HOLE IN TAPE MEASURE TO PUT IN PINS FOR LOCATING CENTER OF CROSSTUBE. ***** 1- Abrade mating surfaces of support and crosstube with 180 grit sandpaper, clean the area with MEK or equivalent as per dwg 2- Install supports with Proseal 890 per D212-664-141 and QSI 015 A/R Proseal 890 Batch: 138784 EXP: 09/18 PROSEAL CURE TIME 72 HOURS: Start: 18-5-11 Finish: 18-5-14 3- Install clamps with rubber cushion (ENSURE CLAMPS ARE INSTALL ON TOP SIDE OF CROSSTUBE) using DT9565 as per Dwg D212-664-141. ***Torque all clamps to 80-100 IN-LBS.***

230 - ***RE-CHECK TORQUE ON CLAMP AFTER PROSEAL HAS CURED FOR 72HOURS AS PER DWG.***

250 - ***VERIFY BY _____ BATCH # TO MATCH W/O _____

255 - Photocopy bluefile and create labels as per PPP D212-664-101 CHG006

260 - Identify and pack for shipping as per PPP D212-664-101 Location : FG094

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D212-664-101TRN	Crosstube Turning Detail	1 Ea (1 ea)	90-Start up Operation	
D2893-1	Support <i>SO 63390</i>	2 Ea (2 ea)	220-Crosstubes	
D3595-063-450	Rubber Cushion 0.63" Wide X 4.50" Long	4 Ea (4 ea)	220-Crosstubes	
MS21920-25	Clamp <i>SO 62603</i>	4 Ea (4 ea)	220-Crosstubes	
AN6-35A	Bolt <i>SO 68660</i>	4 Ea (4 ea)	240-Packaging	<i>SO 3851X1 FM13 8408-213</i>
AN6-36A	Bolt	4 Ea (4 ea)	240-Packaging	<i>SO 36006</i>
D3428-1	Placard	1 Ea (1 ea)	240-Packaging	<i>SO 3851X1</i>
MS21042L6	Nut	6 Ea (6 ea)	240-Packaging	<i>SO 3851X1</i>
NAS1149D0663J	Washer	18 Ea (18 ea)	240-Packaging	<i>SO 28481</i>

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D212-664-101TRN	1	5	0
220-Crosstubes	D2893-1 <i>SO 63390</i>	2	10	0
	D3595-063-450 <i>SO 62603</i>	4	52	0
	MS21920-25 <i>SO 68660</i>	4	107	0
240-Packaging	AN6-35A	4	81	0
	AN6-36A	4	119	0
	D3428-1	1	37	0
	MS21042L6	6	314	0
	NAS1149D0663J	18	1,187	0

Part Specifications

Specifications could not be found.

Plex 4/26/18 3:37 PM Dart.Gagnon.Michelle

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3			X	D212-664-141F	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED)
4	1	1	1	D6005-128	CROSSTUBE
5	2		2	D2893-1	SUPPORT
6	4	4	4	D3595-063-450	RUBBER CUSHION
7		2		D5017-1	SUPPORT
8	4	4	4	MS21920-25	CLAMP (OR MS21920-26)
9	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- FINISH -141 & -141B: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
FINISH -141F: a) ANODIZE PER MIL-A-8625, TYPE II, CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT
***NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN NOT TO CONTAMINATE OR DAMAGE FINISHED SURFACES.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS
- WEIGHT: D212-664-141/-141B/-141F = 33.6 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY

- TO INSTALL D2893-1 / D5017-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 176653



APR 26 2018

RELEASED
2014-05-26

E	ADD -141F. D5017-1 WAS D2893-1 (-141B). PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL. ADD SHEET 3. CLAMPS REVERSED TO PREVENT CHAFING (B7-2, B7-3). BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-3). INCORP. DEO D-1/-2/-3	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C6-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-045 (ZN A6-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D212-664-141	REV. E SHEET 1 OF 5
TITLE XTUBE ASSY (205/212/412 HI FWD)	SCALE NTS
COPYRIGHT © 2008 BY DART AEROSPACE LTD THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMPARISON TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1

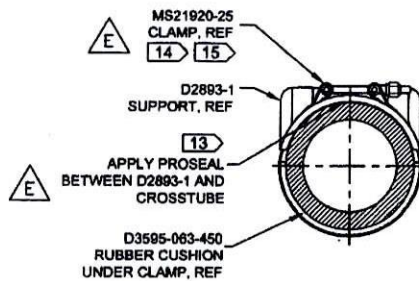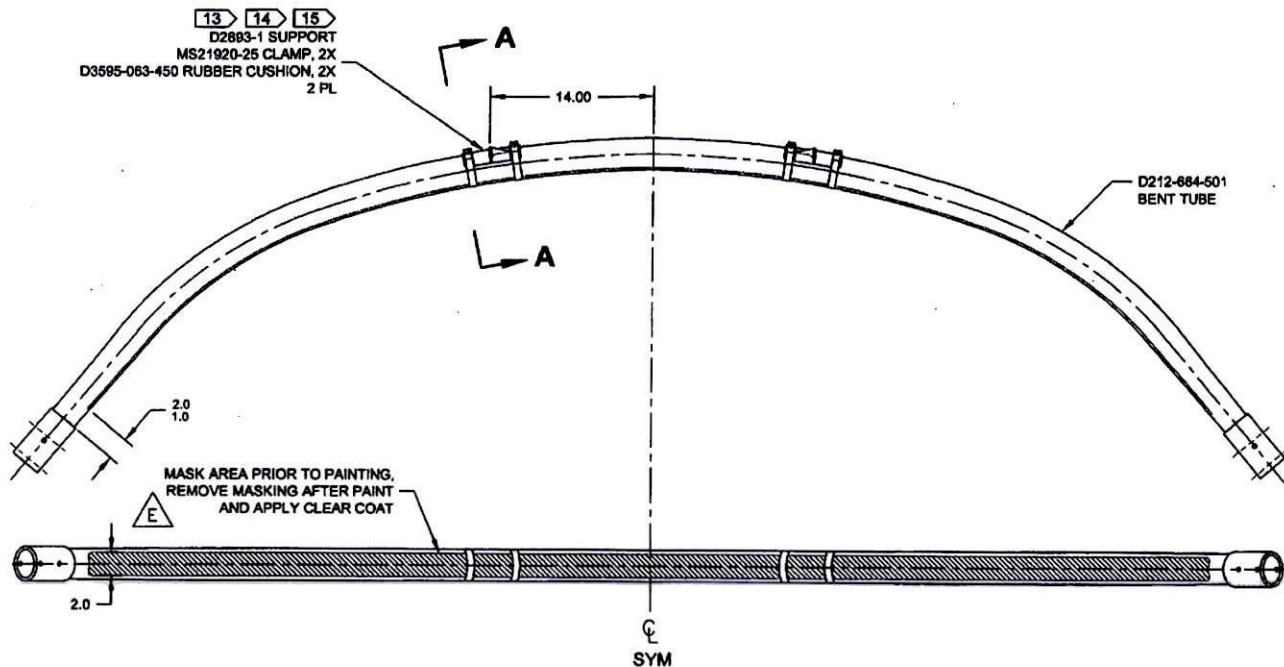


SECTION A-A
SCALE 4X

D212-664-141/-141F
ASSEMBLY DETAIL


RELEASED
2014-05-26
ND

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 2 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASSY (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2005 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1

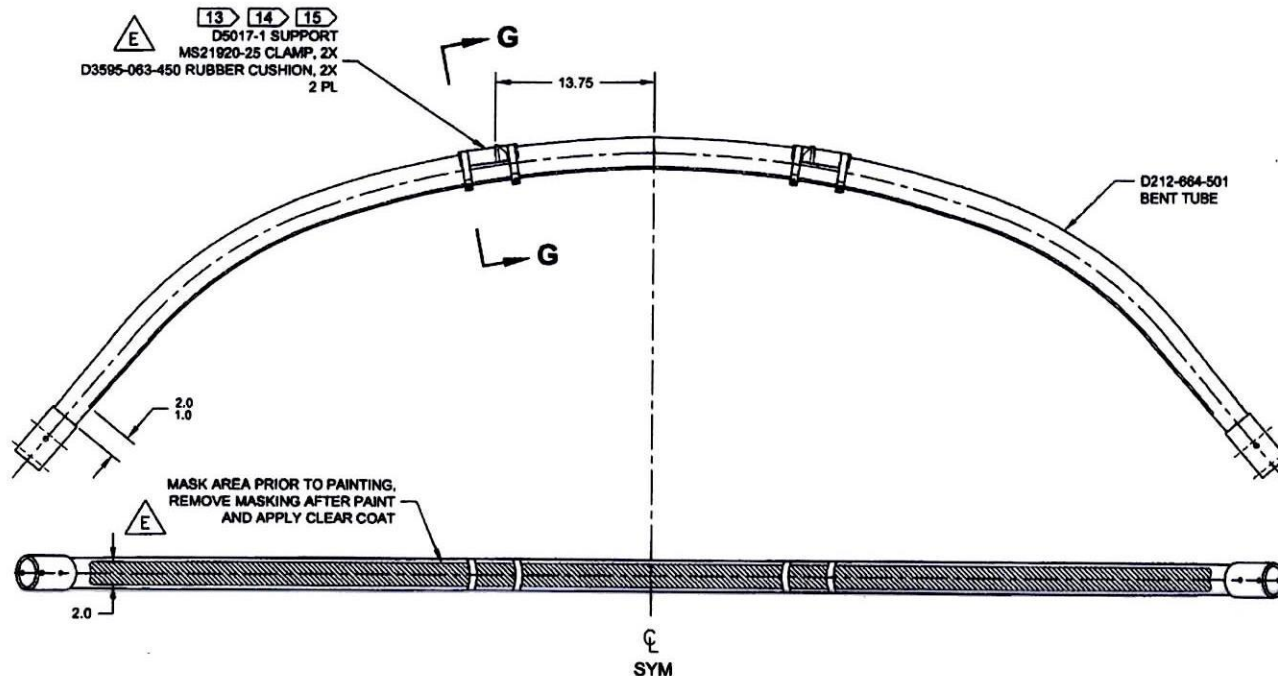


D212-664-141B
ASSEMBLY DETAIL

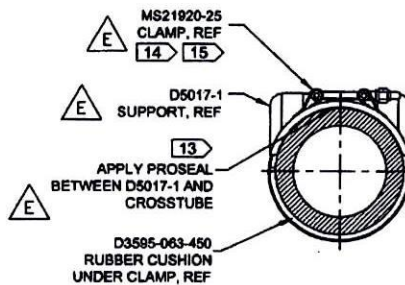


SECTION G-G
SCALE 4X

RELEASED
2014-05-26


DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 3 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

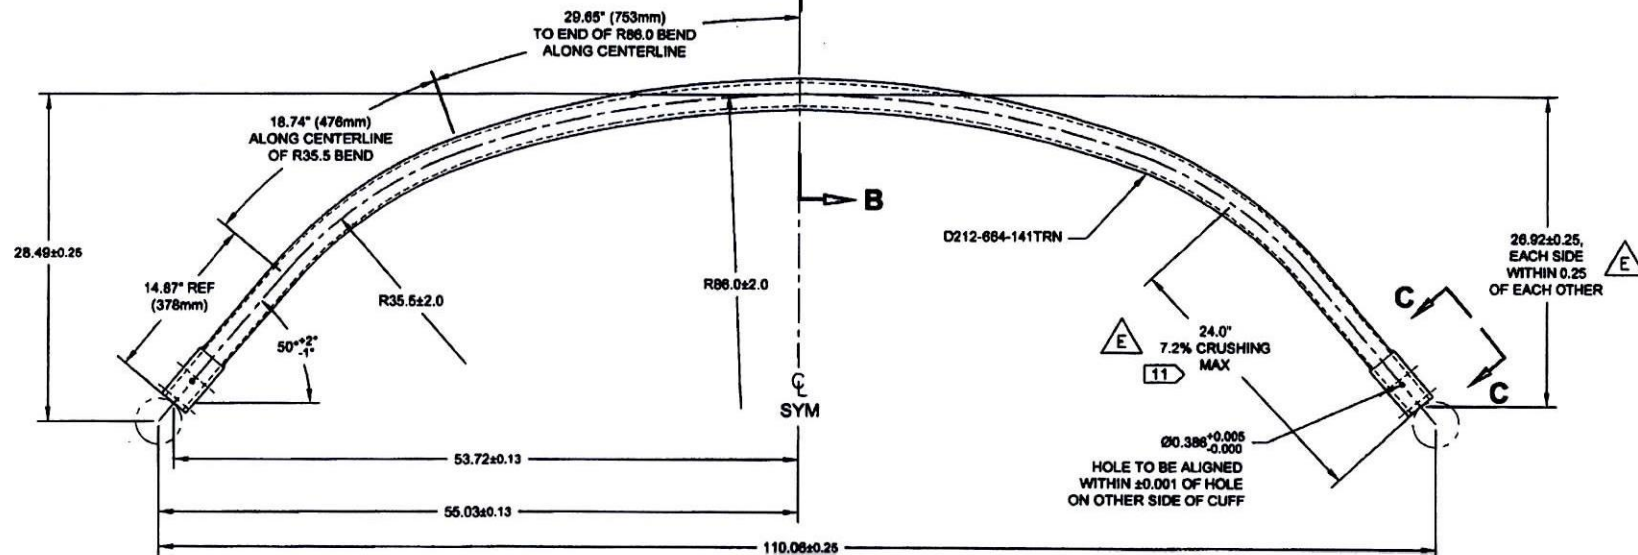

D212-664-501
BENDING AND DRILLING DETAIL

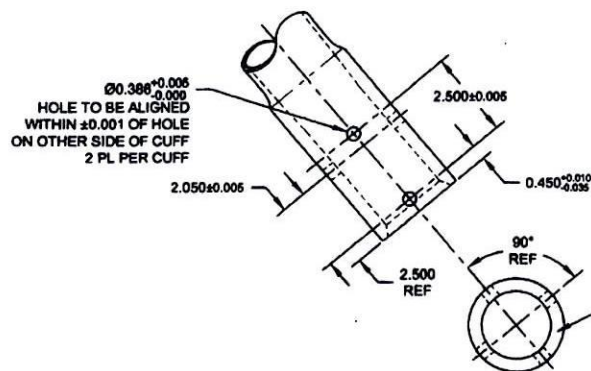


VIEW C-C: CUFF DETAIL
SCALE 3X

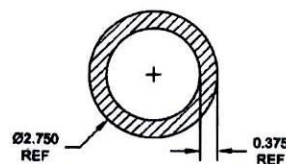

SECTION B-B
SCALE 4X


RELEASED
2014-05-26

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 4 OF 6
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR DISCLOSED OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE LTD.	

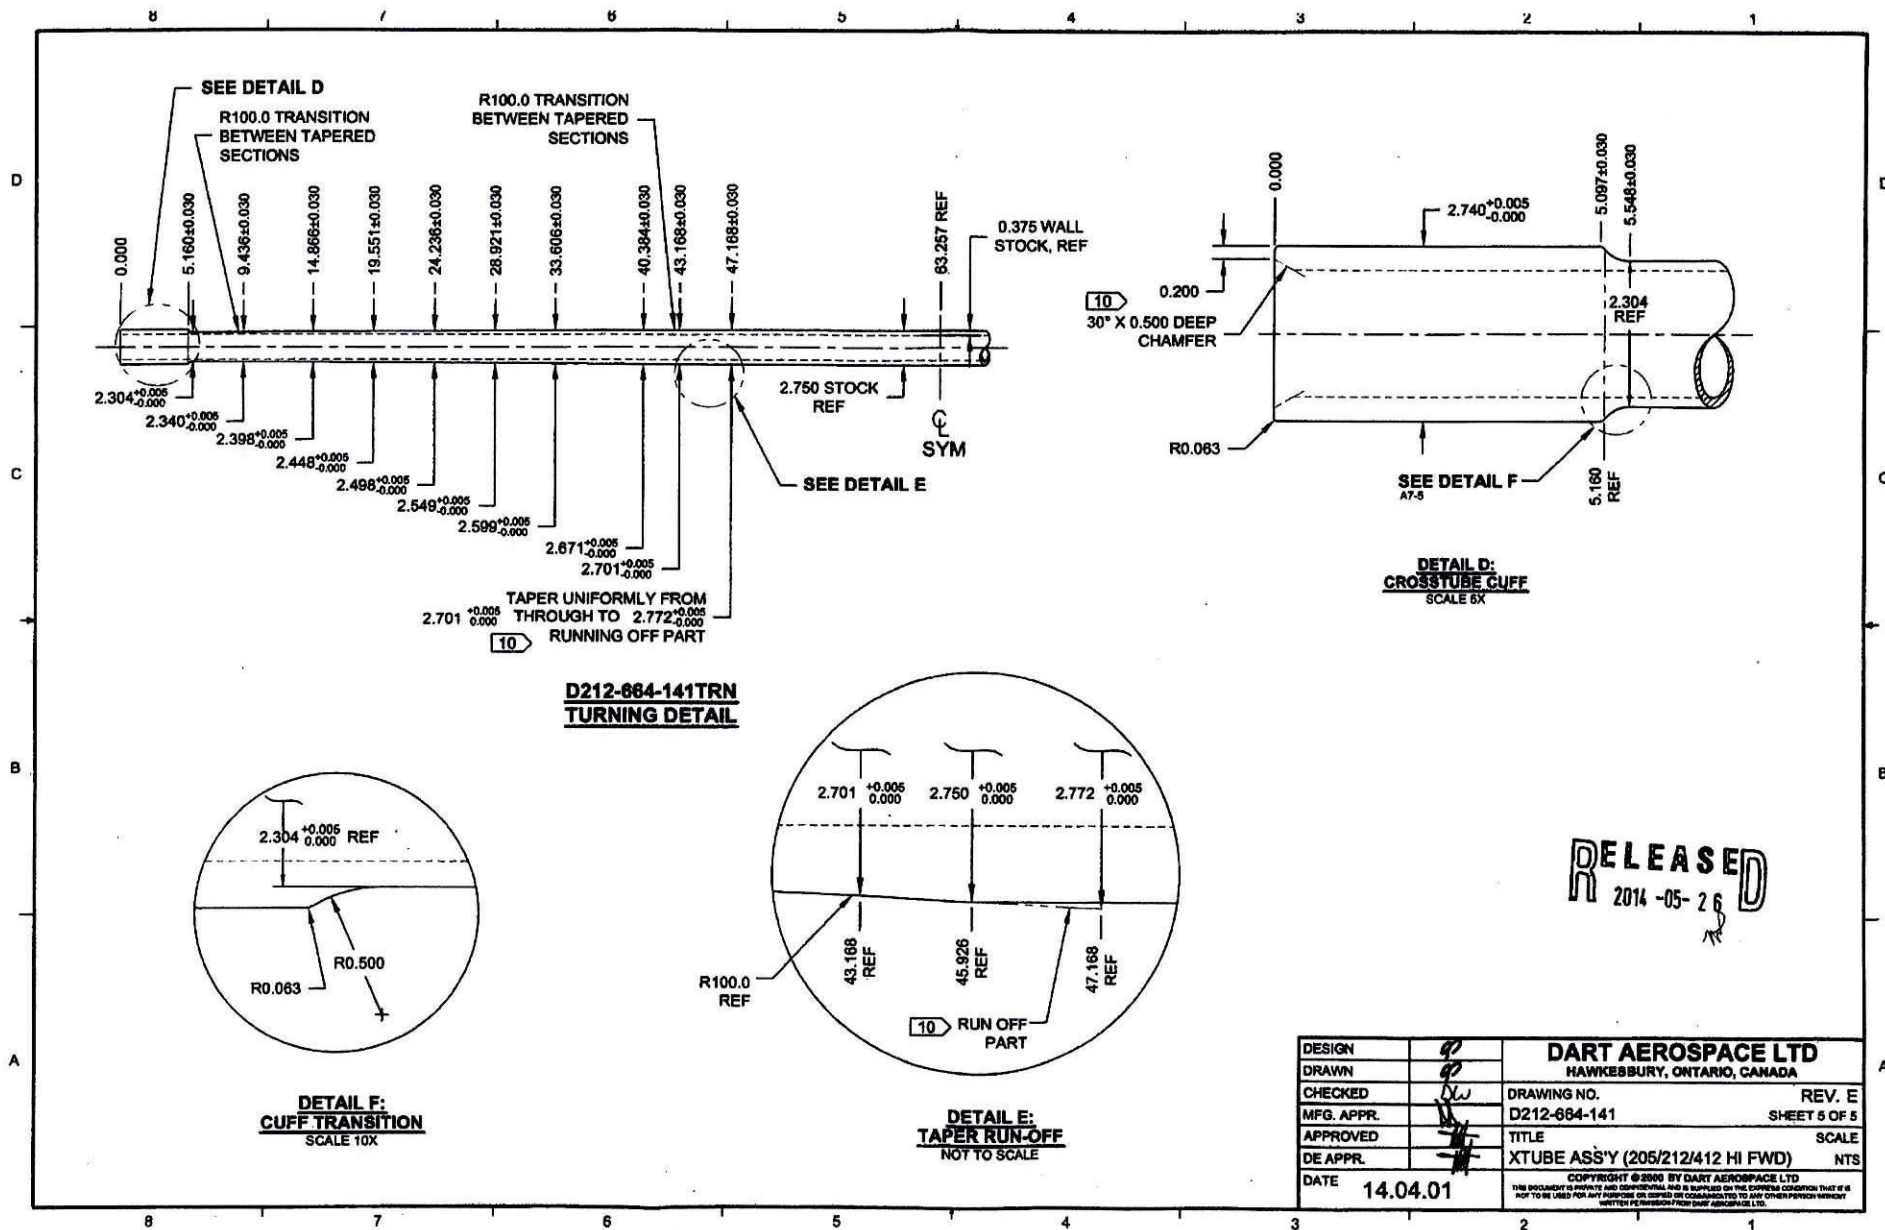

DART AEROSPACE LTD	Work Order: 176653
Description: Crosstube High Fwd (205/212/412)	Part Number: D212-664-101
Inspection Dwg: D212-664-141 Rev: E	Page 1 of 1

Required Dimension	Min	Max
Height	26.67	27.17
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7
Bending Passes	3	--
Crushing	--	7.2%

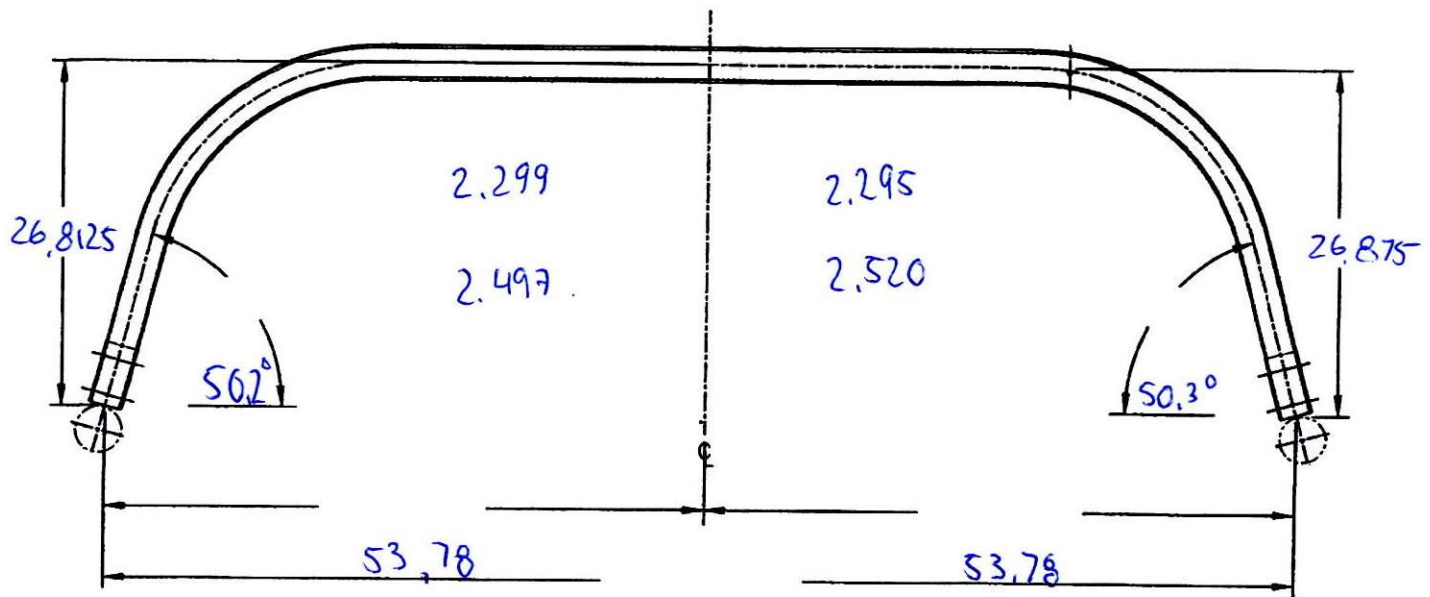

	Side A	Side B
Bending Passes	8	8
Crushing	4.1%	4.7%
Comments		

QC15 Inspection	JW
Date	18-05-1

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	08.04.21	Dwg Rev updated	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	
E	14.07.28	Revised max crushing %	KJ	
F	16.01.15	Revised Height min/max dimensions	KJ	



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER **PO039812**

Supplier: SKY002-VC
Skyservice
6120 Midfield Road
Mississauga
ON
L5P 1B1 Canada
Phone: 905-678-5636
Fax: 905-678-5841

PO No: PO039812
PO Date: 5/7/18
Due Date: 5/10/18
Purchase Order Revision:
Revision Date:
Ship-To Contact: Lavoie, Chantal
Phone: clavoie@dartaero.com

Ship To: 1270 Aberdeen Street
Hawkesbury
ON
K6A 1K7 Canada
Phone: 613-632-5200

Via: Ground
Pynt Terms: Net 30
Freight Terms:
Special Comments:

Items

Line Item	Job	Part	Description	Status	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
1	174297	D4464-041	Fuel Tank Assembly ISSUE P/O : LIQUID PENETRANT INSPECTION AS PER QSI 038 OR LPI AS PER ASTM 1417 LEVEL 2	Firmed	5/10/18	1 pcs	0 pcs ✓ 1x	1 pcs	\$234.00/pcs	\$234.00
2	176652	D212-664-101	Fwd Crosstube - High *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order.	Firmed	5/10/18	1 pcs	0 pcs ✓ 1x	1 pcs	\$224.00/pcs	\$224.00
	176653			Firmed	5/10/18	1 pcs	0 pcs ✓ 1x	1 pcs	\$224.00/pcs	\$224.00
	176654			Firmed	5/10/18	1 pcs	0 pcs ✓ 1x	1 pcs	\$224.00/pcs	\$224.00
	176655			Firmed	5/10/18	1 pcs	0 pcs ✓ 1x	1 pcs	\$224.00/pcs	\$224.00
Sub Total:						4	0	4		\$896.00
3	176291	SWA6A-2-OH	Electric Swivel 6,000 lb Safe Work Load (2,721 kg)	Firmed	5/10/18	1 pcs	0 pcs ✓ 1x	1 pcs	\$89.00/pcs	\$89.00
4	176051	SWA15A-3-OH	Electric Swivel 15,000 lb Safe Work Load (6,818 kg)	Firmed	5/10/18	1 pcs	0 pcs ✓ 1x	1 pcs	\$89.00/pcs	\$89.00
5	176050	SWA15A-3-OH	Electric Swivel 15,000 lb Safe Work Load (6,818 kg)	Firmed	5/10/18	1 pcs	0 pcs ✓ 1x	1 pcs	\$89.00/pcs	\$89.00
6	176762	SWA6A-4-OH	Electric Swivel 6,000 lb Safe Work Load (2,721 kg)	Firmed	5/10/18	1 pcs	0 pcs ✓ 1x	1 pcs	\$89.00/pcs	\$89.00
Grand Total:										\$1,486.00

Order Notes

reid A1 18/05/16

**skyservice****Work Order Traveler**

Sky Service F.B.O. Inc.

10105 Ryan Avenue, Dorval, Quebec, H9P 1A2

TCCA AMO 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO35923	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: PO039812
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	

Task: UNSCHEDULED	Sequence: 1
--------------------------	-------------

Work Required:

CARRY OUT NDT ON:


1 FUEL TANK ASSY P/N# D4464-041 , J/S# 174297

4 FWD CROSSTUBES , P/N# D212-664-101 , J/S# 176652 , 176653 , 176654 , 176655

Action Taken:	Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417M-13 NO CRACK FOUND PEN. ZL-56, MPO13600, CLEANER SKC-S MPO13923 , DEV. MPO11715 , UV LIGHT M-20142	MAY 07 2018	 

Description	Location	P/N	Qty	Batch	S/N Off	S/N On

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

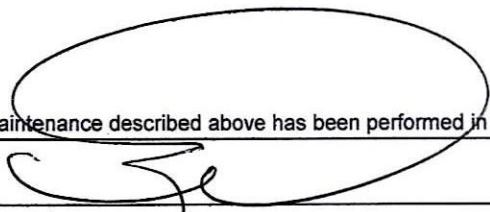Signature: 	ACA/SCA Stamp	Date:
Name: RAFIK MELIKIAN		MAY 07 2018

PAGE 1 OF 1

Description: CROSSTUBE INSTALLATION, HIGH FWD

H:\Forms\Engineer\Approved Eng Online\CHGREC revB

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					